


SONY

SONY Television (AE-1C Chassis)

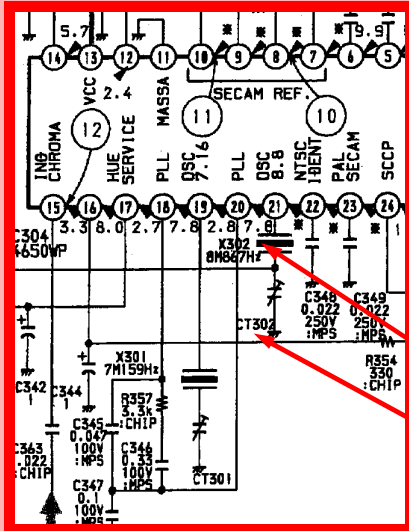

X302

CT302

SYMPTOM: No colour after some time.

REASON: CT302 Defect.

COUNTERMEASURE:
Replace CT302 together with X302

MODELS

KVA2112U

KVA2122U

KVA2512U

KVA2522U

KVA2912U

KVA2922U

Cct Reference	Description	Order Code
CT302	TRIMMER	25005CJ
X302	CRYSTAL	25004FE